HONDA GCV145/170/200 Repair Information

GOVERNOR

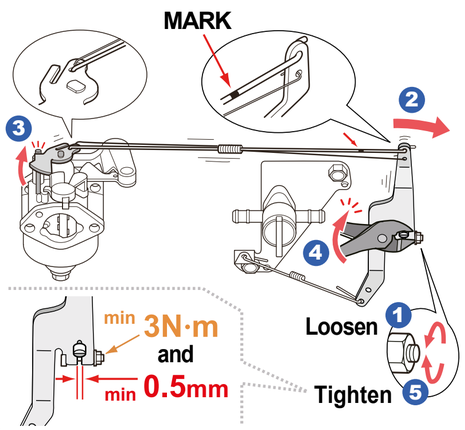

VALVE CLEARANCE

TOP DEAD CENTER
COMPRESSION STROKE

IN/EX 0.10 ± 0.02mm

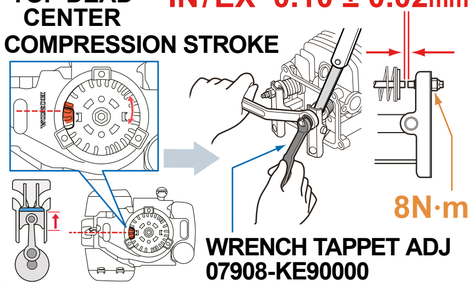

IGNITION

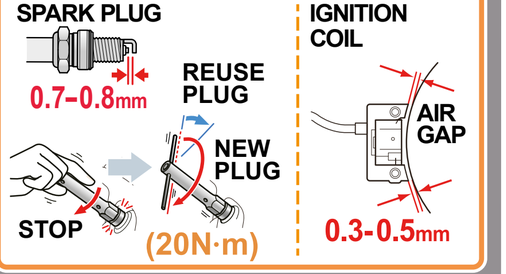

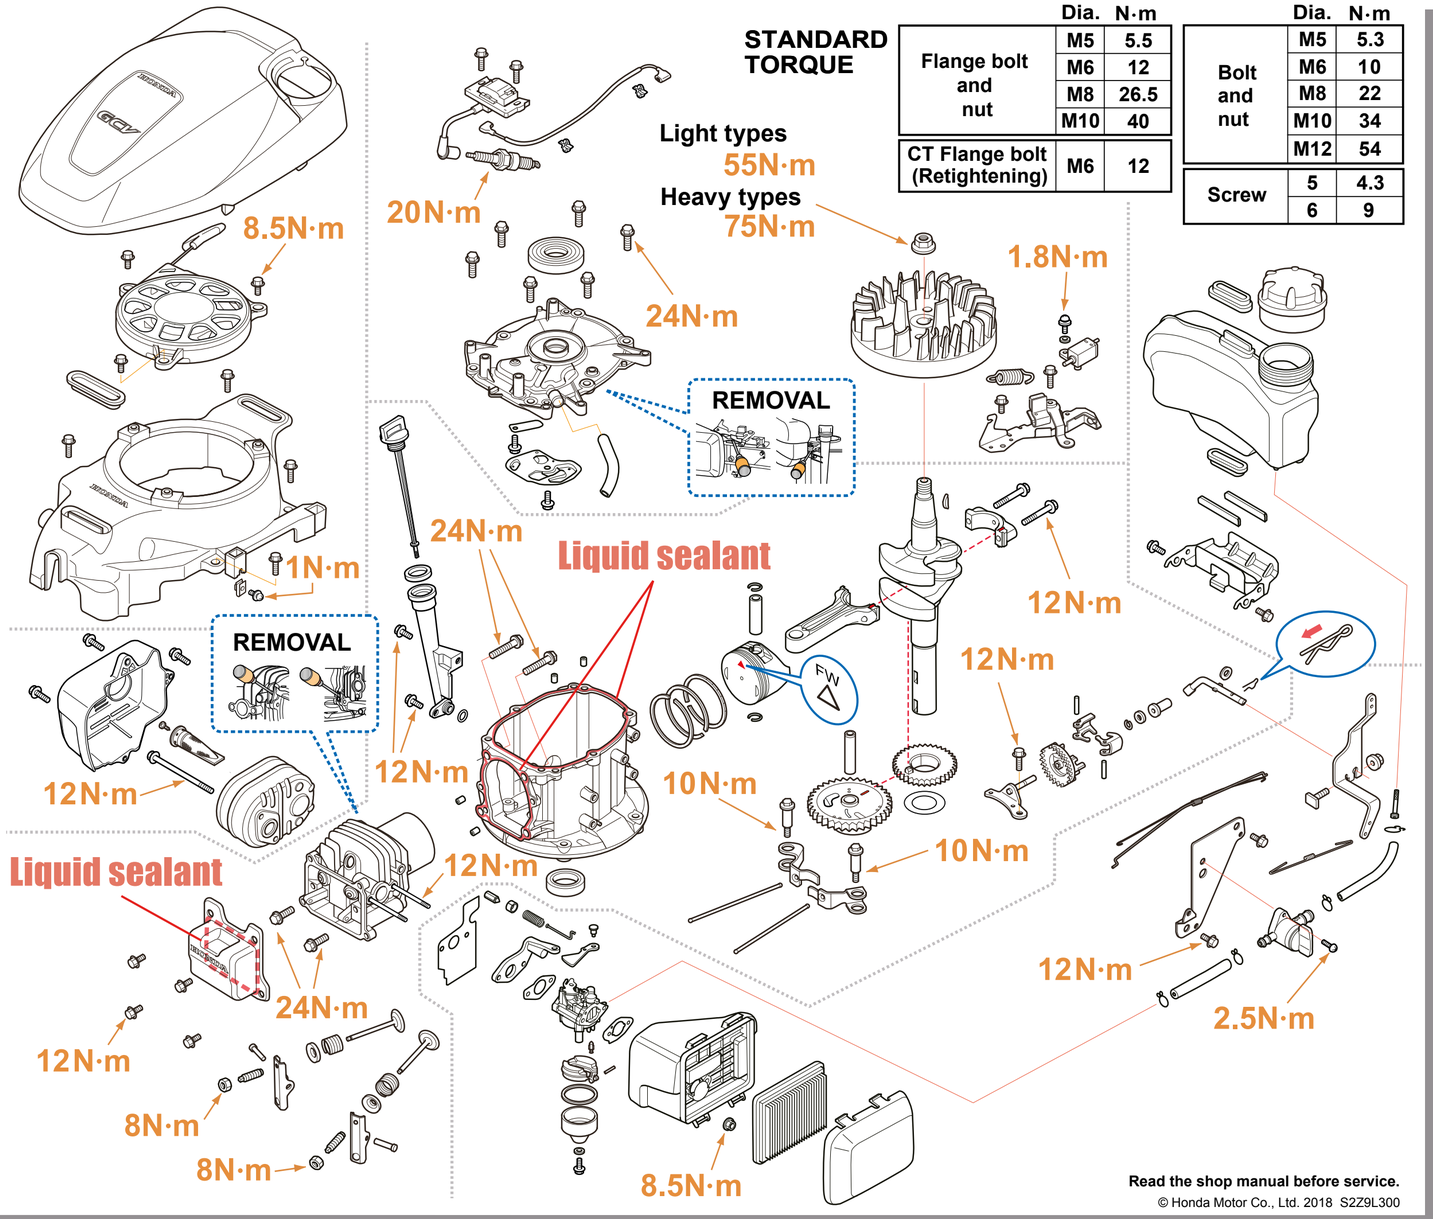

STANDARD TORQUE

	Dia.	N·m
Flange bolt and nut	M5	5.5
	M6	12
	M8	26.5
	M10	40
CT Flange bolt (Retightening)	M6	12

	Dia.	N·m
Bolt and nut	M5	5.3
	M6	10
	M8	22
	M10	34
	M12	54
Screw	5	4.3
	6	9

Read the shop manual before service.
© Honda Motor Co., Ltd. 2018 S2Z9L300

GOVERNED SPEED ADJUSTMENT

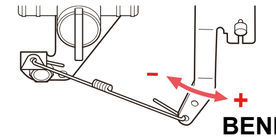

COMPRESSION CHECK

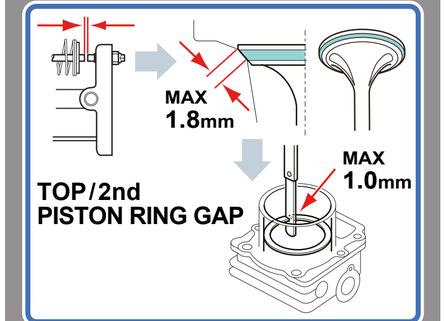

SPARK CHECK

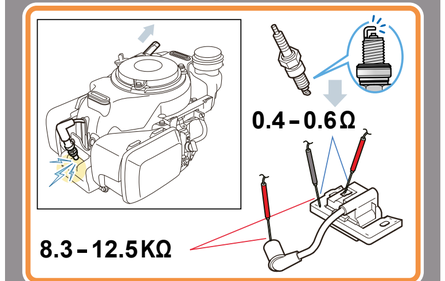

FUEL CHECK

PISTON

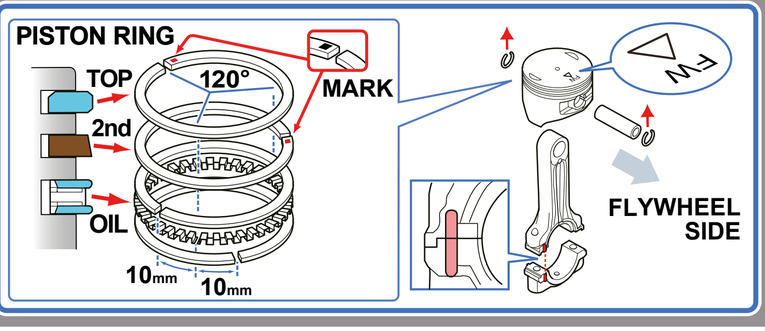

CAM SHAFT

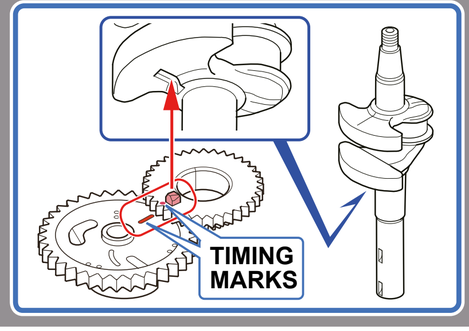

FLYWHEEL

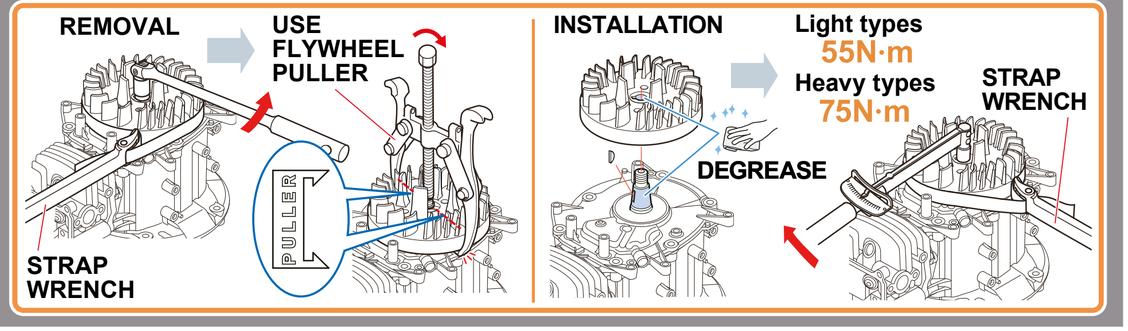

Printed In Belgium - Published by: Honda Motor Europe Logistics NV - Specifications can be changed without notice - Edition: 8460 Aug. 2018